

# **DART SERVICE BULLETIN SB11-5**

AFFECTING:

**D205-770-011 REPLACEMENT ENGINE MOUNT KIT AT CHANGE 003 OR EARLIER**

REF. TCCA STC: SH08-8

REF. FAA STC: SR02690NY / SR02070SE

REF. EASA STC: EASA.IM.R.S.01528

Dart Aerospace Ltd. has received information indicating that the AN3C12A Bolts used at the bottom of D3686-041 Monopod Assembly on **D205-770-011** Replacement Engine Mount Kits at **CHANGE 003 or earlier** may fail in service.

Dart Aerospace Ltd. recommends that operators with aircraft equipped with **D205-770-011** Replacement Engine Mount Kits at **CHANGE 003 or earlier** amend the daily preflight inspection to check the AN3C12A Bolts used at the bottom of the D3686-041 Monopod Assembly for cracks or deformation. If a crack or deformation is noticed, operators must procure DSI 9571-011 Bolt Substitution kit and replace the AN3C12A Bolts with MS21250-03014 Steel Tension Bolts.

Dart Aerospace Ltd. regrets any inconvenience this may cause.

A	NEW ISSUE (REF. NCR11-754)	MB	11.11.23
REV.		DESCRIPTION	BY DATE
DESIGN		<b>DART AEROSPACE LTD</b>	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.	N/A	SB11-5	SHEET 1 OF 1
APPROVED		TITLE	SCALE
DE APPR.		SERVICE BULLETIN	NTS
DATE	11.11.23	COPYRIGHT © 2011 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	